

**Server Memory Compatibility Test Certificate**

Test System: **Supermicro X11SPW-TF (System SYS-5029P-WTR)** Test Result: **Pass**

Leveraged Board(s) / System(s): X11SPW-TF, X11SPW-CTF, X11SPM-TPF, X11SPM-TF, X11SPM-F, X11SPG-TF, SYS-1019P-WTR, SYS-5019P-WT, SYS-5019P-WTR, SYS-5029P-WTR, SYS-5019GP-TT, SYS-1019GP-TT

**Module Specifications**

Rev. 05/16/19

DIMM Vendor	DIMM Part Number	Type	Voltage	Size	Config.	Speed	CL	R/C	Rank	
Kingston	KSM29RD4/64HAR	RDIMM	1.2V	64GB	8192Mx72	2933	21-21-21	B4	2	
DRAM Vendor	DRAM Part Number	DRAM Density / Width / Date Code		Register Vendor / Rev.		DIMM Composition				
SK Hynix	H5ANAG4NAJR-XNC	16Gb		4096Mx4		2005		Rambus	B0	(4096Mx4)*72

**System Configuration**


SETUP	System Information
AVL S/N	H180199-001
System S/N	N80205
Board Rev. (PBA)	1.02
CPU Type	Intel Xeon Gold 6252(PLCX)
Chipset	C621
BIOS / Date	3.0b /3/04/19
BMC / ME	n/a
FRU/SDR	n/a
OS	Ubuntu 16.04 LTS
Test Tool	Stressapptest 1.0.7/Memtest 86+

**Testing Summary**

Test Items	Test Description	Test Results
1. Latest BIOS Upgrade & Configuration check	Record memory Size and Speed detection from BIOS	<b>Done</b>
2. SPD Check	DIMM SPD content check for JEDEC compliance	<b>Pass</b>
3. Reset Cycle	Room	200 Loops <b>Pass</b>
4. Memoy Stress - Memtest86+		2 Loops <b>Pass</b>
5. Memory Stress-Stressapptest	40°C	24Hrs <b>Pass</b>

Note:

**Memory Module Image**

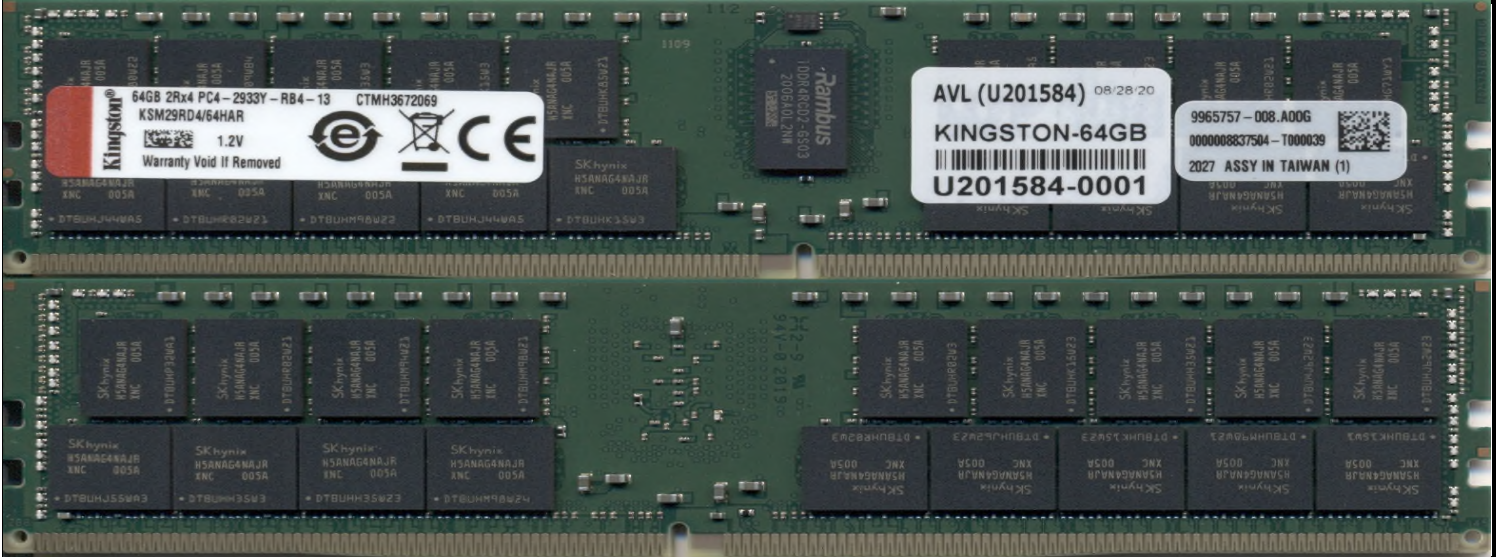

**AVL USE ONLY:**

Completed by:	Van Nguyen	Completion Date:	9/18/2020	AVL A#	U201584	AVL WO	WF7506
Comments:							