



Advanced Validation Labs, Inc.

17665B Newhope Street, Fountain Valley, CA 92708 (714) 435-2630



Server Memory Compatibility Test Certificate

Test System: **Supermicro X11SPW-TF (System SYS-5029P-WTR)** Test Result: **Pass**

Leveraged Board(s) / System(s): X11SPW-TF, X11SPW-CTF, X11SPM-TPF, X11SPM-TF, X11SPM-F, X11SPG-TF, SYS-1019P-WTR, SYS-5019P-WT, SYS-5019P-WTR, SYS-5029P-WTR, SYS-5019GP-TT, SYS-1019GP-TT

Module Specifications

Rev. 3/27/2018

DIMM Vendor	DIMM Part Number	Type	Voltage	Size	Config.	Speed	CL	R/C	Rank
Kingston	KSM29RS8/8HCI	RDIMM	1.2V	8GB	1Gx72	2933	21	D1	SR
DRAM Vendor	DRAM Part Number	DRAM Density / Width / Date Code			Register Vendor / Rev.		DIMM Composition		
Sk Hynix	H5AN8G8NCJR-WMC	8Gb	1024Mx8bit	1915	IDT	C1	(1024x8)*72		

System Configuration


SETUP	System Information
AVL S/N	H180199-001
System S/N	N80205
Board Rev. (PBA)	1.02
CPU Type	Intel Xeon Gold 6252(PLCX)
Chipset	C621
BIOS / Date	3.0b /3/04/19
BMC / ME	n/a
FRU/SDR	n/a
OS	Ubuntu 16.04 LTS
Test Tool	Stressapptest 1.0.7/Memtest 86

Testing Summary

Test Items	Test Description	Test Results
1. Latest BIOS Upgrade & Configuration check	Record memory Size and Speed detection from BIOS	Done
2. SPD Check	DIMM SPD content check for JEDEC compliance	Pass
3. Reset Cycle	Room	200 Loops Pass
4. Memroy Stress - Memtest86+		2 Loops Pass
5. Memory Stress-Stressapptest	45°C	24Hrs Pass

Note:

Memory Module Image

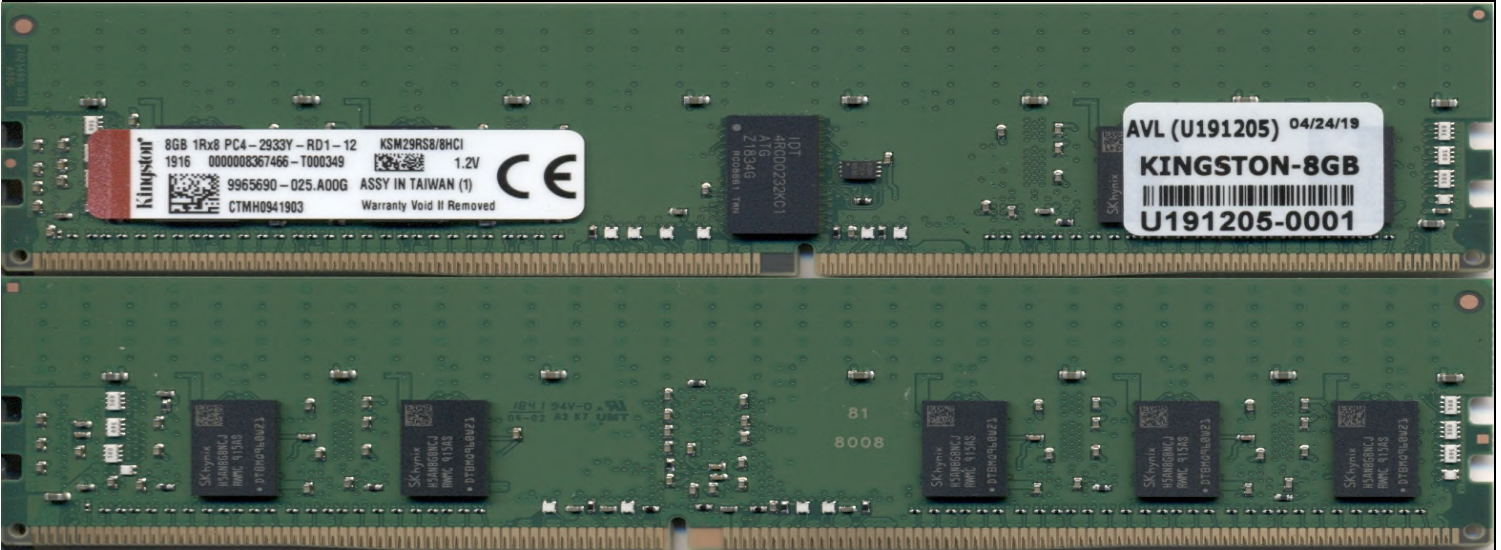

AVL USE ONLY:

Completed by:	Van Nguyen	Completion Date:	6/7/2019	AVL A#	U191205	AVL W/O	WF2460
Comments:							